



# 100% SOLIDS SPRAYABLE POLYURETHANE SERIES APPLICATION GUIDE



Processing 100% solids sprayable Polyurethane requires the use of heated plural component equipment. Our Polyurethane requires heating so both A&B parts have similar viscosities to ensure proper mixing. Refer to product TDS as processing temperature may differ between products, application equipment, and desired finish. Recoat time without additional surface preparation is under 2 hours at 23°C (73°F).

**Normac Adhesive Products Inc.**

1350 Heine Court, Burlington ON  
Canada L7L 6M4  
Tel. 1.905.332.6455  
[info@normacadhesives.com](mailto:info@normacadhesives.com)

# 100% SOLIDS SPRAYABLE POLYURETHANE SERIES

## PROCESSING EQUIPMENT

### Dual Cartridge dispenser system

- Simple training, minimal investment
- Used for smaller applications, R&D, repair, special locations
- See Normac Youtube video - Processing and Operating Instructions

### SFLP-D Processing machine (solvent free low pressure - digital)

- Custom designed by Normac to maximize efficiencies
- Requires NORMAC certificate training
- Used for all sized projects

### High Pressure application system (Graco, PMC)

- Requires training and support from the OEM/distributor

**Polyurethane Conditioning:** It is critical to understand that at no time during heating should the prepolymer (part A) be heated above 88°C (190°F). Excessive heating will reduce material quality quickly, lowering physical properties. Please monitor and record temperatures and times when heating to assure quality.

- Warming methods: microwave, electrical band heater, industrial oven
- Dual cartridge temperatures between 50°C to 55°C (120°F to 130°F)
- Processing machine temperatures Part A 80°C (177°F), Part B 23°C (73°F or room temperature)
- Refer to individual product TDS for processing temperatures
- Part A - No mixing is required
- Part B – Power mix or shake thoroughly to achieve a homogenous mixture
- If resin (Pt A) is highly viscous and has a “frozen” like appearance, slowly warm back to processing temperature. This “unfreezing” can take up to one day at 50°C (120°F) depending on volume
- For more information see *“Heat History during Pre-heating and Processing Polyurethanes”* data sheet

**Application Conditions:** Ambient and surface temperature should be similar and between 10°C to 45°C (50°F to 113°F). Warming surfaces and surrounding air is a good option when working in colder temperatures. Relative humidity should be below 85% and dew point is maintained 3°C (5°F) above substrate temperature for the duration of the application. Higher temperatures will speed cure times. It is possible to spray at lower temperatures when dewpoint and humidity levels are safe, expect cure times of all products to lengthen. Always protect the surface from contaminants and direct sunlight.

**Pot life / Working Time:** Under 2 minutes at 23°C (73°F) at 50% relative humidity. Pot life correlates with temperature, humidity, and mass. The higher the temperature, the larger the mass, the shorter the pot life. Typically, the softer the durometer the longer the pot life.

**Demasking:** Never leave demasking / trimming until the following day. The first hour of curing is called “the green stage”. At this stage, demasking and final trimming take place as the material has not reached final cross-linking and therefore can be trimmed with minimal force. After 2 hours of cure, demasking will become difficult.

**Ultimate Cure Time:** This time depends on temperature. The warmer the ambient temperature the faster the material will cure. 80% material cure can be realized after 24 hours at room temperature 23°C (73°F). The final 20% will take 5 days. Post curing parts are not required but can be done at a maximum of 60°C (140°F) for 24 hours to speed up ultimate cure time.

# 100% SOLIDS SPRAYABLE POLYURETHANE SERIES

## SAFETY / PPE

- Read and understand the SDS for each product used
- Use respirators including organic vapor cartridges and pre-filters
- Full face mask or respirator with disposable lens covers are recommended
- A supplied clean air system when working in a confined space environment
- Disposable spray suits, gloves, and footwear are recommended

## STORAGE / SHELF-LIFE

- Keep all materials in a cool dry place out of direct sunlight
- Storage temperature range of 15°C to 30°C (60°F to 86°F)
- Pay attention to shelf life of 2+ years and rotate stock
- Only open containers as they are required
- Remove atmospheric moisture with dry nitrogen before resealing resin part A

## SURFACE PREPARATION

### GENERAL

All substrates must be clean and dry with no oil, grease, or loose debris. NORMAC Polyurethane products use primers to successfully adhere to both porous and non-porous substrates. Individual adhesion tests should be performed to confirm adequate adhesion strength prior to use.

### METAL

Metal substrates must be dry, clean, and sound. Remove all dirt, dust, grease, oils, detritus, and all other contaminants. Radius all sharp edges to minimum 3 mm (.120"), grind uneven seam lines, and remove weld splatter. Previously used metal should be checked for contamination that may require additional cleaning. Abrasive grit-blasting to SSPC-SP10 near white including a minimum depth profile of 2 microns (.002") is recommended for maximum adhesion strength. Other forms of mechanical roughening to clean and profile are possible such as grinding but expect lower adhesion strength. All metals require NP-9500 to achieve maximum adhesion strength. NP-9600 is used in conjunction with NP-9500 for immersion service only. Specialty and some hardened metals will require adhesion testing to ensure acceptable results.

**Salt Contaminated Surfaces/Efflorescence:** Metal surfaces that have been immersed for any time in salt solutions should first be grit-blasted to remove existing coating. For best results, power wash with hot water using minimum 120°C (248°F) to flush capillary residue. Quickly force dry completely using open propane torch flame to evaporate dissolved salts. Repeat steps until salt contamination has reached a maximum of 15mg/sqm. Finish by grit-blasting to specification.

## 100% SOLIDS SPRAYABLE POLYURETHANE SERIES

### ELASTOMERS

Elastomer substrates include cured Rubber, Polyurethane, Polyurea, and PVC belting. Surface must be dry, clean, and sound. Remove all dirt, dust, grease, oils, detritus, and contaminants by solvent clean and choose the appropriate method for mechanical roughening to achieve desired adhesion strength. De-glossing using abrasive blast cleaning and or power tool cleaning, to achieve a minimum depth profile of 25 micron (.001"). Grinding or sanding using slow speed rotation (under 2000 rpm) by heavy wire wheel, or 24 to 50 grit aluminum oxide disks can achieve results. Elastomers require either NP-8400 or NP-9500 primer to ensure maximum adhesion strength.

### CONCRETE

Concrete surfaces are plane, and must be clean, sound, and dry. For best results, uneven profiled and blow-holed surface imperfections should be repaired and allowed to cure to a smooth level surface prior to mechanical roughening. Grit-blasting and grinding are best to achieve a minimum depth profile of 50 microns (.002"). Remove any dust, laitance, grease, oil, dirt, detritus, and all other contaminants from the concrete. New concrete must be cured for a minimum of 28 days with less than 15% moisture content. The compressive strength of the concrete substrate should be at least 20 MPa (3000 psi) at the time of application. Concrete requires NP-100 primer to ensure adequate adhesion strength and to stop outgassing. NP-100 can be mixed with aggregate to make high strength repair mortars.

### OTHER SUBSTRATES

These substrates include Carbon Fiber, Fiberglass, and Wood. Surface must be dry, clean, and sound. Remove all dirt, dust, grease, oils, detritus, and contaminants by solvent clean and choose the appropriate method for mechanical roughening for desired adhesion strength. De-glossing using abrasive blast cleaning and or power tool cleaning, to achieve a minimum depth profile of 25 micron (.001"). Use NP-9500 primer to ensure maximum adhesion strength. Wood is porous and may not require primer.

**Note:** Cured product results will vary as each application has specific service condition variables. NORMAC cannot accept responsibility for determining the suitability of an existing coating as a substrate for our products. The Owner or their Representative shall perform adhesion tests on any existing substrate to determine suitability.

# 100% SOLIDS SPRAYABLE POLYURETHANE SERIES

## METAL PRIMER APPLICATION

### NP-9500 PRIMER

- Two coats of NP-9500 are required for all metal applications; 30 minutes between coats.
- PU top-coat window is 6 hours. If you find yourself outside the window, simply re-prime.
- The 2nd coat of primer can be applied at a maximum of 5 days after the 1st coat.
- A two-part system, mixed ratio of 3A to 1B by weight only. Shake both parts well before use.
- Applied by roller, brush, or spray.
- Dilute using MEK solvent up to 25% depending on application method.
- A DFT of 50 microns (0.002") is required.

### FOR IMMERSION SERVICE ONLY

### NP-9600 WASH PRIMER

- One thin coat is required, used in conjunction with NP-9500 primer only.
- Applied a minimum 6 hours before topcoating with NP-9500 primer.
- Mix each part well prior to use. It's recommended to scrape the bottom of the "A" side can.
- A two-part system, mixed ratio of 100A to 91B by weight. 1:1 by volume.
- Applied to prepared metal using roller, brush, or spray.
- Dilute using MEK solvent up to 25% depending on application method.
- A DFT of 12.5 microns (0.0005") thickness is required.

## POLYURETHANE SPRAY TECHNIQUES

- Expect 250 micron (0.010") per wet pass.
- Spray at 90 degrees to the substrate whenever possible.
- Use the theory of "light coats" and many coats.
- While spraying, look for the gloss and move on.
- Cross hatching whenever possible.
- Measure thickness to understand what you are achieving per pass.
- Coat hard to access areas first, before moving to easy open areas.
- Trim any drips or sags prior to the last few coats for best finish appearance.

**Recoat and Repair for Polyurethane:** Surface preparation for over-coating becomes necessary when more than 2 hours have elapsed, or you wish to adhere to previously coated urethane. NP-9500 primer is used to bond new urethane to previously applied urethane using one coat of 25 micron (0.001") after proper surface preparation has been completed.

### Surface Prep Options:

- Grit-blasting using a medium to coarse grit size. Plan to remove the gloss and 50 micron (.002") of existing coating.
- Sanding with a slow speed sander at 2000 rpm or less and a 24, 36, 50 grit aluminum oxide sanding disks. Plan to remove the gloss and 50 micron (.002") of existing coating.
- Wire brush attachment on a grinder or drill. Use a slow speed under 2000 rpm. Plan to remove the gloss and 50 micron (.002") of existing coating.

# 100% SOLIDS SPRAYABLE POLYURETHANE SERIES

## TROUBLESHOOTING

SYMPTOM	POTENTIAL CAUSE	POSSIBLE SOLUTIONS
<b>Runs and sags</b>	Excessive thickness per pass	Spray each pass thinner Wait one min to overcoat
<b>Delamination</b>	Exceeding recoat window Off ratio mixing	Recoat window is under two hrs Mix products according to TDS
<b>Blisters</b>	Off ratio mixing Contamination Solvent has not flashed off At dew point water entrapment	Mix products according to TDS Check and clean contaminants Ensure primer is dry Check environment conditions
<b>Uneven surface finish</b>	Material Temperature Air Atomization	Part A 80C (176F), Part B 23C (74F) Adjust for proper atomization

## DISCLAIMER

*The direction for the use of our products are based upon tests believed to be reliable but no warranty is given. Since conditions for the use of this product are beyond the seller's control, all risks are assumed by the user. Please contact your local agent or call Normac Adhesive Products Inc. (905) 332.6455 for further assistance.*



**Normac Adhesive Products Inc.**  
1350 Heine Court, Burlington ON  
Canada L7L 6M4  
Tel. 1.905.332.6455  
info@normacadhesives.com